

Date: Friday, 1/27/2006 7:54:13 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 L HIGH GEAR SKIDTUBE  
 Job Number : 25632A  
 Estimate Number : 10539  
 P.O. Number : N/A Part Number : D206642341  
 This Issue : 1/27/2006 S.O. No. : N/A Drawing Number : D2650 REV D1  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D1  
 Previous Run : 25631A Material : N/A  
 Written By : SEE COMMENT BELOW Due Date : 2/20/2006 Qty: 1 Um: Each  
 Checked & Approved By : [Signature]  
 Comment : Est Rev: H 05.10.41 Added D3429-1 per CHG004 KJ/CP/JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-341CHG002

See B25632

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2620 Bent Tube 3" OD B24497

DP 06-2-6 ①

3.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2647 Fwd Cap B20535

BE 06-02-07 ①

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube DP06-2-6 ①

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP06-2-6 ①

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod m15855/m19100 BE 06-02-07 ①

4-Grind weld flush to cap on top surface only.

BE 06-02-07 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:54:13 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end to length as per dwg D2650

DP 06-2-8 ①

6-Drill pilot holes using drill Jig DT8168A (A,B & C). Open to Ø0.312"

DP 06-2-8 ①

7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297"

DP 06-2-8 ①

8-Open using #6 Drill Bit

DP 06-2-8 ①

9-Open holes for Tow Ring to Ø0.640" as per Dwg D2650, D2650-5 Drilling Detail

DP 06-2-8 ①

10-Remove inner indexing ridge on aft end of skidtube as per Dwg D2650

DP 06-2-8 ①

11-Deburr and Blow out all chips from inside the tube

DP 06-2-8 ①

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Q.m 06-02-08 ①

6.0

D26545

206 L Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2654-5

Web

B21093

fm 06-02-09 ①

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-5 Drilling Detail (without cutting fluid)

fm 06-02-09 ①

2-Countersink crossbolt spacer holes as per Dwg D2650 (without cutting fluid)

fm 06-02-09 ①

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

fm 06-02-09 ①

4-Bond D2654-5 web in place as per QSI 015 Ensure holes line up Allow 12 Hrs. cure time before cutting

Start Date: 06-02-09 Time: 8:15

Finish Date: 06-02-13 Time: 12:00

A/R Sikaflex-291 m19597

Sikaflex expiry date: 06-06-14

fm 06-02-09 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:54:13 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description:

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total: 17.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

17 D2649

Crossbolt spacer

*B-24200 BE 06-02-14 (1)*

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

*m18839 BE 06-02-14 (1)*

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

*BE 06-02-16 (1)*

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Debur

*BE 06-02-16 (1)*

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2680-041

Nut Plate

*B21103 Pm 06-02-17 (1)*

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 CCR264SS3-3

Rivets

*m18548 Pm 06-02-17 (1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:54:13 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

m7808

Pm 06-02-17 (1)

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

Pm 06-02-17 (1)

15.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

June 20  
PD 06-02-20

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

SC 06/07/06

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

PL 06/07/08 (1)

18.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

B25904

19.0

D265611

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-11

Wearshoe

B16357

PL 06/07/08 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Friday, 1/27/2006 7:54:13 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe B24846

21.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-35

Wearshoe B24148

22.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad B24417

23.0

ALS41032130

Insert



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 ALS4-1032-130

Inserts M18293

or (see QSI 017)

24.0

AN960JD10L

Washer



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 AN960JD10L

Washer M101291

PL 06/07/08 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:54:14 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS27039108

Screw



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 MS27039-1-08

Screw

M19551

26.0

D26511

Plug



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-1

Plugs

B25144

27.0

D26513

O-Ring



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-3

O-Rings

B23491

28.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer

M11151

29.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

M4874

DL 06/07/08 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:54:14 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2646

Aft Cap B25381

31.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 AN960JD10L

Washer M101291

32.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 MS27039-1-08

Screw M19551

DL 06/07/08 ①

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/06

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/06

6-Wing Walk as per Dwg D2650-5 and QSI 005 4.4

Batch: M101266

FC

06 07 10 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: D Date: 06/07/24  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:54:14 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25632A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

QC3/5



QC5

INSPECT WORK/WING WALK

MA 0718

QC3 ①



Comment: INSPECT WORK/WING WALK

12/6/2/15 ①

35.0

PACKAGING 1



PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: —

N/A PD

36.0

DC



DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

06.07.20

Job Completion



u 06.07.17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries





DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2650	REV. D SHEET 1 OF 5
DATE 04.05.17		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	

RELEASED  
04.06.22 *[Signature]*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

#### NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-2 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY  
RETURN TO  
ENGINEERING


UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

WORK ORDER  
NO. 25632A



Copyright © 1997 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



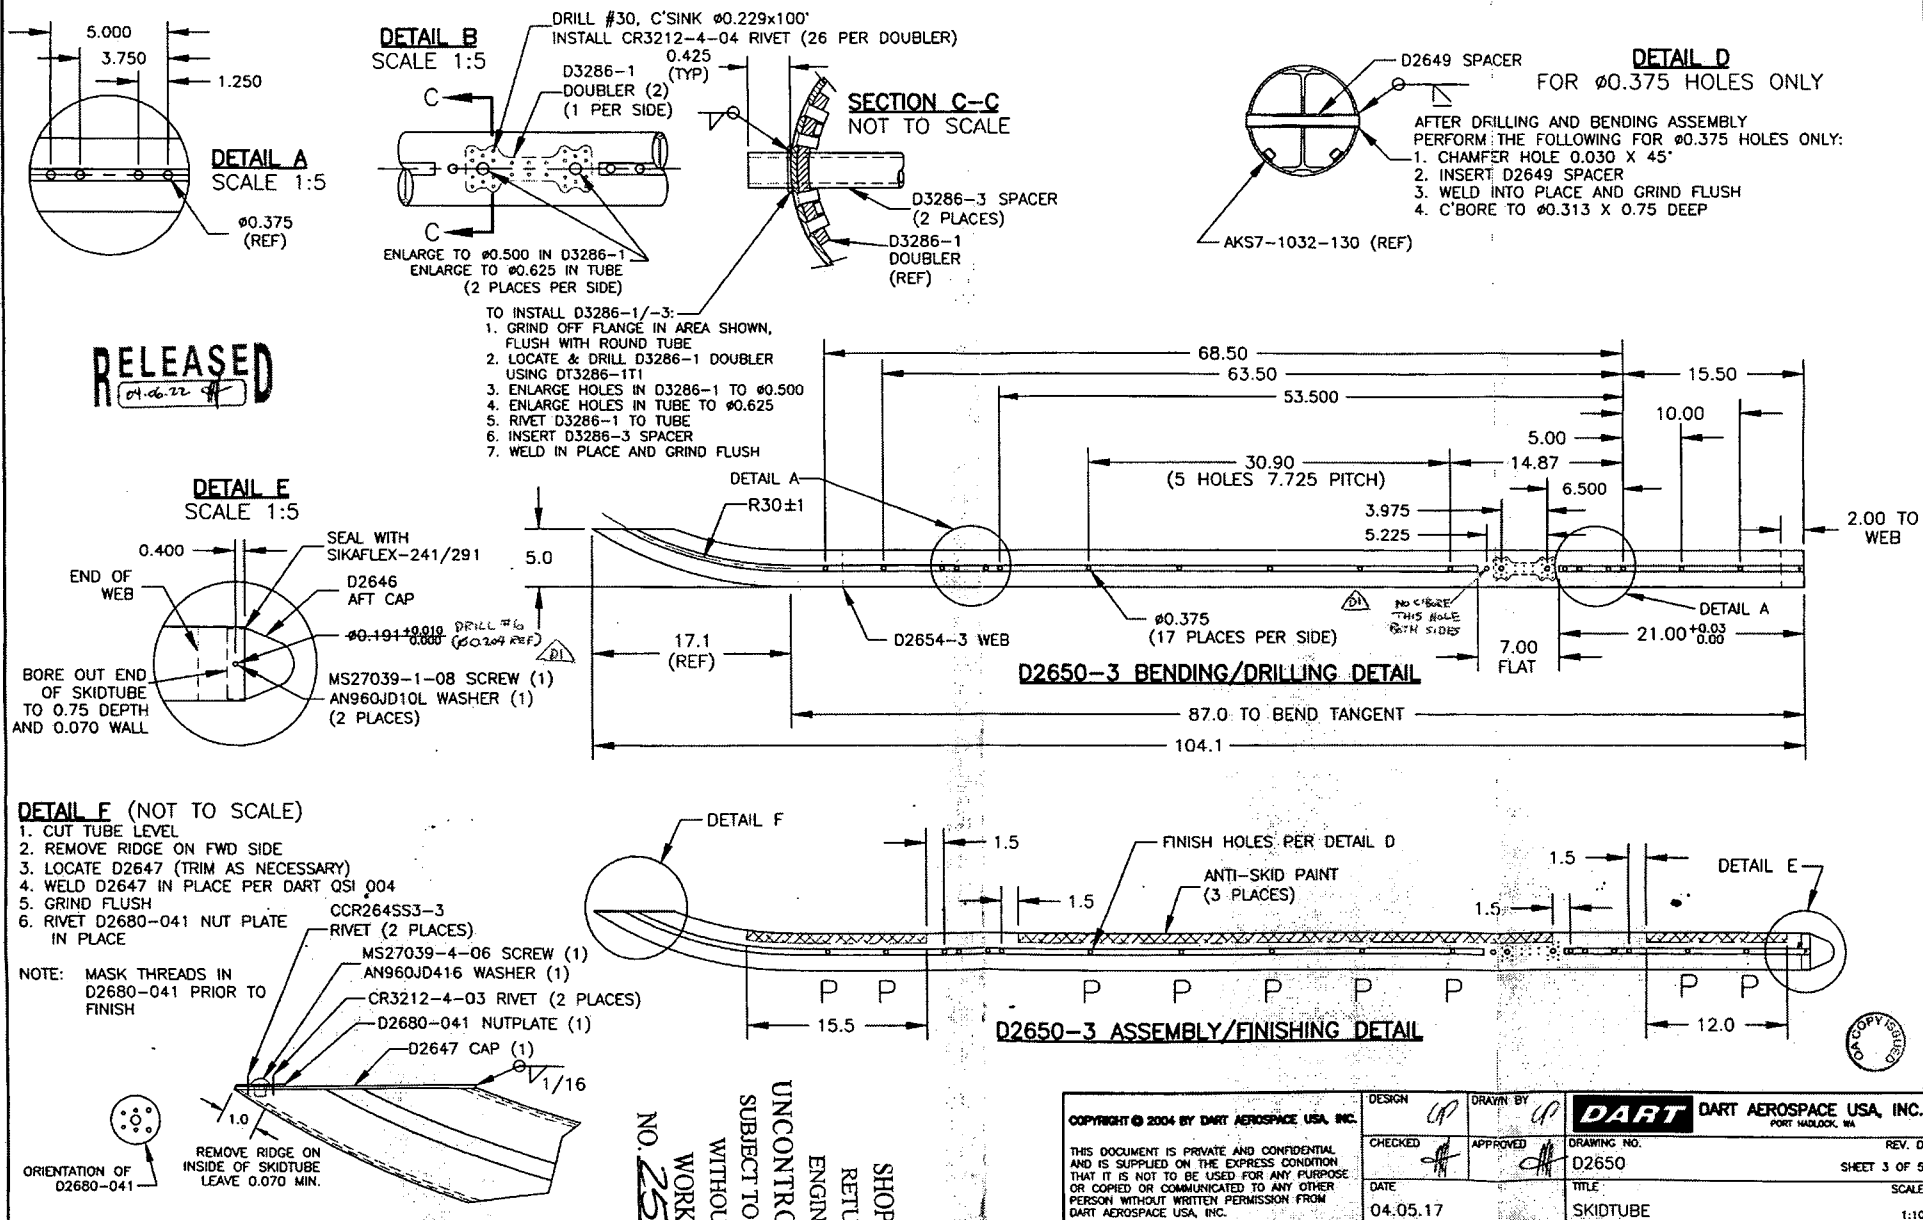

 SHOP/COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 25832A

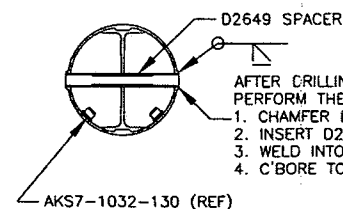

**DETAIL D**  
FOR Ø0.375 HOLES ONLY

 
AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

1. CHAMFER HOLE 0.030 X 45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C BORE TO Ø0.313 X 0.75 DEEP



REMOVE RIDGE ON  
INSIDE OF SKIDTUBE  
LEAVE 0.070 MIN.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 25632A

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	DESIGN UP	DRAWN BY UP	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, MA	
	CHECKED #	APPROVED #	DRAWING NO. D2650	REV. D
	DATE 04.05.17	TITLE SKIDTUBE		SCALE 1:10

